

## Y-120 – S-3 HDI<sup>®</sup> Yarn

S-3 HDI<sup>®</sup> glass fiber yarns are typically used for the manufacture of high-performance glass fiber fabrics. The fabrics are designed to meet the technical requirements of high-density interconnect (HDI) technology in PCBs – especially integrated circuit (IC) package substrates.

### **General Product Specifications**

#### **Product Information**

Dura dar et	005005	000450	0001200	CCDC1 500	66863888	CCD C2200	00000750
Product	SCE225	SCD450	SCC1200	SCBC1500	SCBC3000	SCBC3200	SCBC3750
Glass Type	S-3 HDI	S-3 HDI	S-3 HDI	S-3 HDI	S-3 HDI	S-3 HDI	S-3 HDI
Filament Diameter - µm	7	5	4.5	4	4	4	4
Binder	622	622	620-1	620-1	620-1	620-1	620-1
Bobbin	7636	7636	7636	7636	7636	7636	7636
Plies	1/0	1/0	1/0	1/0	1/0	1/0	1/0
Nominal Yield - yd/lb	22,500	44,940	120,000	150,000	300,000	319,850	375,000
Tex - g/1000 m	22.05	11.02	4.14	3.31	1.65	1.55	1.32
Tex Tolerance +/-	1.32	0.66	0.33	0.26	0.13	0.12	0.11
Nominal Solids - %	1.40	1.40	2.70	2.80	2.80	2.60	3.35
Solids Tolerance +/-	0.30	0.30	0.40	0.40	0.40	0.50	0.50
Nominal Twist - TPI	1.0Z	1.0Z	1.0Z	1.0Z	0.2Z	0.2Z	0.7Z
(TPM)	(Z40)	(Z40)	(Z40)	(Z40)	(Z8)	(Z8)	(Z28)
Twist Tolerance +/- TPI (TPM)	0.30 (12)	0.30 (12)	0.30 (12)	0.30 (12)	0.06 (4)	0.06 (4)	0.21 (4)
Maximum Broken Filaments*	10	10	10	10	10	10	10
Minimum Tensile** - Ib (N)	2.4 (10.7)	1.6 (7.1)	0.40 (1.8)	0.30 (1.3)	0.15 (0.7)	0.15 (0.7)	0.15 (0.7)
	-						

\* Broken filaments based on average 360° count

\*\* Average of 5 measurements per bobbin

### **Nominal Product Characteristics**

(For reference only, not specified or controlled)

Average Bare Glass Tensile* - Ib	3.8	2.3	0.95	0.80	0.41	TBD	0.36
(N)	(16.9)	(10.2)	(4.2)	(3.6)	(1.8)		(1.6)
Approximate Yarn Diameter - in	0.0065	0.0048	0.0030	0.0024	0.0011	0.0011	0.0011
(mm)	(0.165)	(0.122)	(0.076)	(0.061)	(0.028)	(0.028)	(0.028)

\* Average tensile per bobbin

### Packaging Information

Bobbin	7636	7636	7636	7636	7636	7636	7636
Nominal Bobbin Weight - Ib (kg)	3.0 (1.36)	1.1 (0.49)	1.0 (0.45)	1.0 (0.45)	1.0 (0.45)	1.0 (0.45)	1.0 (0.45)
Minimum Bobbin Weight - lb (kg)	0.50 (0.23)	0.25 (0.11)	0.25 (0.11)	0.25 (0.11)	0.25 (0.11)	0.25 (0.11)	0.25 (0.11)
Metered Bobbin Length - yd (m)	64,100 (58,600)	46,200 (42,200)	115,000 (105,100)	150,000 (137,100)	105,000 (96,000)	320,000 (292,600)	131,200 (120,000)
Metered Ratio - %	70	70	50	50	50	50	50


Rev 25, 09/10/2021



# Y-120 – S-3 HDI<sup>®</sup> Yarn

### **Nominal Packaging Dimensions**

Bobbin	Pallet	Bobbins / Layer	Layers / Carton	Cartons / Pallet	Bobbins / Pallet	L-in (cm)	W-in (cm)	H-in (cm)	
7636	Wood	18	3	4	216	45.5 (115.6)	45.5 (115.6)	45.5 (115.6)	

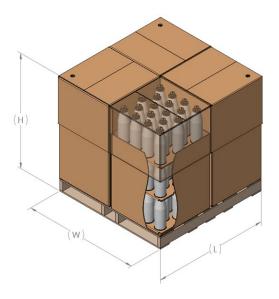

## Storage, Shelf Life and Handling

#### Storage and Shelf Life:

AGY recommends storing the materials in accordance with appropriate safety considerations, away from exposure to the elements and at 65-80F (18-27C) and 50-70% humidity. If the materials are stored under these conditions, they are stable, non reactive and will not degrade or exhibit negative characteristics for at least 3 years from the date of manufacture. Unused, unopened product older than this is likely still in good condition, however careful evaluation is recommended. Prior to use, pallets should be placed in the production area and any plastic wrap removed for a minimum of 24 hours to allow the material to acclimate to the processing environment. Special care should be given to pallets being moved from a cold environment into a warm, humid area as condensation may occur and this additional moisture can negatively impact the runability of the material, however, once the material has acclimated, this will no longer be an issue.

For product traceability reasons, the pallet label should be recorded or retained.

#### Handling:

Fiberglass products process best if temperature and humidity are controlled, primarily because this will help to minimize the buildup of static electricity, fuzz and fly. AGY recommends that the material be run at 70 +/- 5 degrees F (18-27C) and 60 +/- 5% RH.

## **Test Methods and Certificates**

A copy of test methods and or a certificate of conformity may be issued upon request.

Packages will be firmly and evenly wound on the bobbin, and free from defects in workmanship. AGY accepts no responsibility for damaged material that shows any signs of physical abuse.

#### For additional product information, refer to PTS M-710

AGY – World Headquarters / Americas 2556 Wagener Road Aiken, South Carolina, USA 29801 Phone: +(1) 888.434.0945 (toll free) +(1) 803.643.1501 Fax: +(1) 803.643.1180 Email: asktheexpert@agy.com AGY – Europe Le Gemellyon Nord 57 Boulevard Marius Vivier Merle 69003 Lyon, France Phone: +(33) 4727 81775 Fax: +(33) 4727 81780

### www.agy.com