

Y-220 – G Filament and Heavier Yarn

G filament yarns are used in further fabrications such as warping and weaving for glass fabrics and tapes.

General Product Specifications

Product Information

Product	ECG37			ECG75		ECG150	
	E			E		E	
Glass Type	E			E		E	
Filament Diameter - µm	9	9	9	9	9	9	9
Binder	620-1	620-1	723	620	723	620	636
Bobbin	8542	8571	8571	8571	8571	8542	8542
Plies	1/0	1/0	1/0	1/0	1/0	1/0	1/0
Nominal Yield - yd/lb	3,700	3,700	3,700	7,300	7,300	15,000	15,000
Tex - g/1000 m	134.10	134.10	134.10	68.00	68.00	33.10	33.10
Tex Tolerance +/-	9.20	9.20	9.20	3.70	3.70	2.10	2.10
Nominal Solids - %	1.40	1.40	1.40	1.37	1.40	1.30	1.27
Solids Tolerance +/-	0.25	0.25	0.28	0.18	0.28	0.25	0.21
Nominal Twist - TPI (TPM)	0.7Z (Z28)	0.7Z (Z28)	0.5Z (Z20)	0.7Z (Z28)	0.7Z (Z28)	0.7Z (Z28)	0.7Z (Z28)
Twist Tolerance +/- TPI (TPM)	0.21 (8)	0.21 (8)	0.15 (6)	0.21 (8)	0.21 (8)	0.21 (8)	0.21 (8)
Maximum Broken Filaments*	10	10	10	10	10	10	10
Minimum Tensile** - lb (N)	10.0 (44.5)	10.0 (44.5)	17.0 (75.6)	5.7 (25.4)	9.0 (40.0)	3.2 (14.2)	3.2 (14.2)

* Broken filaments based on average 360° count

** Average of 5 measurements per bobbin

Nominal Product Characteristics

(For reference only, not specified or controlled)

Average Bare Glass Tensile* - lb (N)	17.4 (77.4)	17.4 (77.4)	23.0 (102.3)	9.2 (40.9)	11.5 (51.2)	4.5 (20.0)	4.5 (20.0)
Approximate Yarn Diameter - in (mm)	0.0156 (0.396)	0.0156 (0.396)	0.0156 (0.396)	0.0106 (0.269)	0.0106 (0.269)	0.0080 (0.203)	0.0080 (0.203)

* Average tensile per bobbin

Packaging Information

Bobbin	8542	8571	8571	8571	8571	8542	8542
Nominal Bobbin Weight - lb (kg)	8.4 (3.81)	19.0 (8.62)	18.9 (8.57)	19.4 (8.80)	19.5	9.1 (4.13)	9.1 (4.13)
Minimum Bobbin Weight - lb (kg)	2.0 (0.91)	5.0 (2.27)	6.0 (2.72)	5.0 (2.27)	6.0 (2.72)	2.0 (0.91)	2.0 (0.91)
Metered Bobbin Length - yd (m)	30,000 (27,400)	68,200 (62,300)	68,500 (62,600)	141,100 (129,000)	141,100 (129,000)	136,500 (124,800)	133,100 (121,700)
Metered Ratio - %	80	80	70	70	65	70	70


Rev 27, 08/31/2021

Indicates a product that is made to order, which may impact availability. Please contact your AGY representative for more information.

Y-220 – G Filament and Heavier Yarn

Nominal Packaging Dimensions

Bobbin	Pallet	Bobbins / Layer	Layers / Carton	Cartons / Pallet	Bobbins / Pallet	L-in (cm)	W-in (cm)	H-in (cm)
8542	RPPU	28	3	2	168	52.0 (132.1)	45.5 (115.6)	46.0 (116.8)
8571	RPPU	15	2	2	60	51.5 (130.8)	45.5 (115.6)	42.0 (106.7)

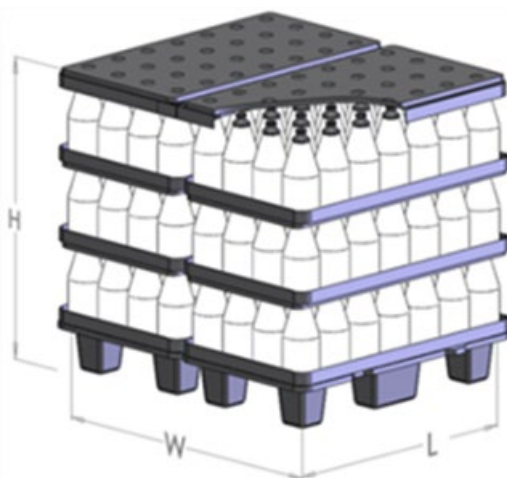

NOTE: Picture above is an example of the RPPU packaging, please see the table above for accurate bobbin counts.

Storage, Shelf Life and Handling

Storage and Shelf Life:

AGY recommends storing the materials in accordance with appropriate safety considerations, away from exposure to the elements and at 65-80F (18-27C) and 50-70% humidity. If the materials are stored under these conditions, they are stable, non reactive and will not degrade or exhibit negative characteristics for at least 3 years from the date of manufacture. Unused, unopened product older than this is likely still in good condition, however careful evaluation is recommended. Prior to use, pallets should be placed in the production area and any plastic wrap removed for a minimum of 24 hours to allow the material to acclimate to the processing environment. Special care should be given to pallets being moved from a cold environment into a warm, humid area as condensation may occur and this additional moisture can negatively impact the runability of the material, however, once the material has acclimated, this will no longer be an issue.

For product traceability reasons, the pallet label should be recorded or retained.

Handling:

Fiberglass products process best if temperature and humidity are controlled, primarily because this will help to minimize the buildup of static electricity, fuzz and fly. AGY recommends that the material be run at 70 +/- 5 degrees F (18-27C) and 60 +/- 5% RH.

Test Methods and Certificates

A copy of test methods and or a certificate of conformity may be issued upon request.

Packages will be firmly and evenly wound on the bobbin, and free from defects in workmanship. AGY accepts no responsibility for damaged material that shows any signs of physical abuse.

For additional product information, refer to PTS M-710

AGY – World Headquarters / Americas
 2556 Wagener Road
 Aiken, South Carolina, USA 29801
 Phone: +(1) 888.434.0945 (toll free)
 +(1) 803.643.1501
 Fax: +(1) 803.643.1180
 Email: asktheexpert@agy.com

AGY – Europe
 Le Gemellyon Nord
 57 Boulevard Marius Vivier Merle
 69003 Lyon, France
 Phone: +(33) 4727 81775
 Fax: +(33) 4727 81780